


INSTRUCTIONS

CAT. # 2C9-17
SINGLE INSTRUMENT
CHARGE AIR TEMPERATURE
100-300 F.

! IMPORTANT !

The gauge will work on 12 or 24 VDC. systems
Use with WESTACH 399 series senders

For lighting, order light kit # 186-12A2

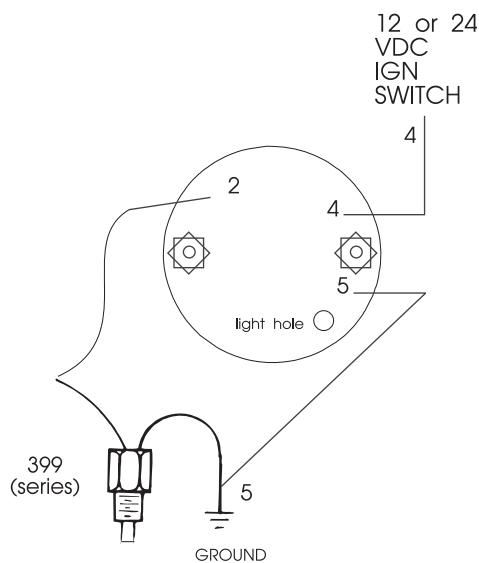

Install the instrument in a 2 1/16 inch hole, in convenient operating place. Use U clamp to hold in place.

Install temperature sender into medium to be measured. Route wires away from spark plug wires and hot manifolds, support with wire ties every 12-15 inches.

On the rear of the instrument there are connecting pins with corresponding numbers.

Use patch cable provided to connect the instrument to the sending unit.

Connect pin #2 to either sender lead. Connect other lead to a good engine ground. Connect pin #5 to same ground as sender. Connect pin #4 to 12/24 VDC. See illustration.

Patch cable may be shortened or lengthened without affecting accuracy of unit. Using 20-22 gauge stranded wire is recommended.

WARRANTY

WESTACH INSTRUMENTS are made with the highest quality material and workmanship. With reasonable care, instruments will give long and satisfactory service. WESTACH INSTRUMENTS are guaranteed against defective material and workmanship for 12 months from the manufacturing date. For complete details go to www.westach.com



WESTBERG MFG. INC.
www.westach.com